INVOICE



DATE

REPORT#

ESCROW#

PROPERTY LOCATION

3704 Robinson Place, San Diego CA 92103

TO: Compass

8889 Rio San Diego Drive Ste 200

San Diego, CA 92108 ATTN: Sabine Steck

05/02/2022 420906

04/29/2022

Inspection

\$100.00

Balance Due:

\$100.00

RETAIN THIS COPY FOR YOUR RECORDS

DUE AND PAYABLE WITHIN 10 DAYS

1.5% per month charged on all past due accounts. This is an annual percent 18% (Interest charged persuant to the Robinson-Patman Act)

NOTICE: "Under the Mechanics'Lien law, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property but is not paid for his work or supplies, has the right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your own contractor in full, if the subcontractor, laborer, or supplier remains unpaid."

THANK YOU FOR YOUR BUSINESS

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

BUILDING NO. STREET, CITY, STATE, ZIP Date of Inspection No. of Pages 7 4/29/2022 92103 3704 Robinson Place, San Diego CA Termite and (619) 462-5577 Pest Control (619) 462-1700 Fax 3638 Bancroft Drive Spring Valley, CA 91977 www.d-and-s-termite.com Report No. 420906 Escrow No. Firm Registration No. PR 1164 Report Sent To: Property Owner/Party of Interest Ordered By: Compass Julio Garcia Coop Compass 8889 Rio San Diego Drive Ste 200 3704 Robinson Place 8889 Rio San Diego Drive Ste 200 San Diego, CA 92108 San Diego, CA 92103 San Diego, CA 92108 Attn: Sabine Steck Attn: Sabine Steck REINSPECTION REPORT SUPPLEMENTAL REPORT COMPLETE REPORT X LIMITED REPORT Inspection Tag Posted: General Description: 1-2 story, single family residence, frame and stucco construction, flat and tile roof Sub Area Other Tags Posted: SD Fume Company 2017 An inspection has been made to the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected. Drywood Termites X Further Inspection Fungus/Dryrot x Other Findings X Subterranean Termites If any of above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items

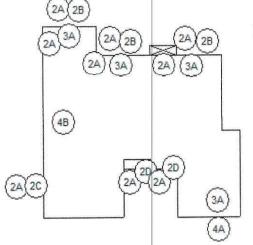


Diagram not to scale, findings in approximate locations.

Inspected by

Randy L. Krok

State License No. FR 28418

Signature

43M-41 (Rev. 04/2015)

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceeding two years Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural

Pest Control board at (916) 561-8708, or (800) 737-8188 or www.pestboard.ca.gov.

Robinson Place, San Diego CA 92103

4/29/2022

420906

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

There are certain areas of the structure, which are considered impractical for inspection: furnished interiors; inaccessible attics or portions thereof; the interior of hollow walls, spaces between a floor or porch deck and the ceiling or soffit below; stall showers over finished ceilings; such structural segments as porte cocheres, enclosed bay windows, buttresses, and similar areas to which there is no access with out defacing or tearing out lumber, masonry or finished work; built-in cabinet work; abutments, or floors beneath coverings, areas where storage conditions, heavy vegetation or locks make inspection impractical. These areas (but not limited to) are considered inaccessible and were not inspected at this time. Note Appliances and/or plumbing over finished ceilings are not water tested and we do not certify against leakage, unless otherwise noted in this report. No evidence of leaks were noted in the roof covering system however, no opinion is rendered nor is guarantee implied concerning the future water tightness of the roof. This firm makes no guarantee against any infestation, leaks, or other adverse conditions which may exist or which may develop in inaccessible areas and become visibly evident after the date of this inspection. This inspection is only of the structures indicated on the diagram. Estimate and Report good for one hundred twenty days. The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors State License Board.

NOTICE:..Reports on this structure prepared by various registered companies should list the same findings (i.e. Termite infestations, termite damage, fungus damage etc.). However recommendations to correct these findings may vary from company to company.. You have a right to seek a second opinion from another company.

This company will reinspect repairs done by others within four months of the original inspection. A charge of half the original inspection fee will be charged for each re inspection. There inspection must be done within ten(10) working days of request. The re inspection is a visual inspection and if inspection of concealed areas in desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs. Section 1993.1 S.P.C.B Rules & Regulations. This company will not certify eradication of termites completed by others.

Note: This wood destroying organisms report does NOT include mold or mold like conditions. Mold is NOT a wood destroying organism and is outside the scope of this report as defined by the Structural Pest Control Board Act Rules and Regulations. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

Our expert opinion limited, the source of moisture may be caused by factors unknown or unseen at the time of inspection. You are advised to contact an expert in the field of moisture conditions.

NOTE: D&S Termite inspectors are not equipped with second story ladders. We do not inspect any items over (12) twelve feet above ground level. D&S Termite can not be responsible for conditions existing above this level. Should you desire an inspection above our limits, we will schedule an appointment for an inspector properly equipped to do so. There may be an additional charge of \$250.00 for this service.

This is a separated report. Which is defined as section I and section II conditions evident on the date of inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II. Section 1990(f)S.P.C.B. Rules & Regulations.

Robinson Place, San Diego CA 92103

4/29/2022

420906

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

2. Drywood Termites:

FINDING 2A

FINDING: Evidence of drywood termites noted in exposed wood members of residence, see 2A on diagram.

RECOMMENDATION 2A

RECOMMENDATION: Fumigate entire structure with lethal fumigant Sulfuryl Fluoride (VIKANE) Introduce Chloropicrin (tear gas) as needed as a warning agent. Fumigation will assure complete elimination of drywood termites, cover or clean up all visible and accessible pellets as needed. Fumigation notice and pesticide disclosure MUST be read and signed prior to injection of fumigant. Fumigation guaranteed for two years. ALL FUMIGATIONS CANCELED LESS THAN 72 HOURS PRIOR TO SCHEDULED DATE WILL BE SUBJECT TO A CANCELLATION FEE OF 25% OF THE FUMIGATION COST.

***** This is a Section 1 Item *****

FINDING 2B

FINDING: Evidence of drywood termite damage noted in door sills / thresholds, and door jambs of residence, see 2B on diagram.

RECOMMENDATION 2B

RECOMMENDATION: Remove and replace or repair drywood termite damage as needed. Work completed by D&S Termite guaranteed for one year. If certification is required D&S Termite must re inspect work completed by others. D&S Termite does not guarantee work completed by others. D&S Termite & Pest Control will apply primer coat, but cannot be responsible for match of color. If during the course of repair work, fungus and/or termite damage extends into inaccessible areas, there may be an additional charge for repairs. D&S Termite & Pest Control will contact you about additional charges if any.

****** This is a Section 1 Item ******

FINDING 2C

FINDING: Evidence of drywood termite damage noted in window sills / frames of residence, see 2C on diagram.

RECOMMENDATION 2C

RECOMMENDATION: Remove and replace or repair drywood termite damage as needed. Work completed by D&S Termite guaranteed for one year. If certification is required D&S Termite must re inspect work completed by others. D&S Termite does not guarantee work completed by others. D&S Termite & Pest Control will apply primer coat, but cannot be responsible for match of color. If during the course of repair work, fungus and/or termite damage extends into inaccessible areas, there may be an additional charge for repairs. D&S Termite & Pest Control will contact you about additional charges if any.

***** This is a Section 1 Item *****

FINDING 2D

FINDING: Evidence of drywood termite damage noted in beam tails of residence, see 2D on diagram.

Robinson Place, San Diego CA 92103

4/29/2022

420906

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

2. Drywood Termites:

RECOMMENDATION 2D

RECOMMENDATION: Remove and replace or repair drywood termite damage as needed. Work completed by D&S Termite guaranteed for one year. If certification is required D&S Termite must re inspect work completed by others. D&S Termite does not guarantee work completed by others. D&S Termite & Pest Control will apply primer coat, but cannot be responsible for match of color. If during the course of repair work, fungus and/or termite damage extends into inaccessible areas, there may be an additional charge for repairs. D&S Termite & Pest Control will contact you about additional charges if any.

***** This is a Section 1 Item *****

3. Fungus/Dryrot:

FINDING 3A

FINDING: Fungus damage noted in door sills / thresholds, and door jambs of residence, see 3A on diagram.

RECOMMENDATION 3A

RECOMMENDATION: Remove and replace or repair fungus damaged wood as needed. Work completed by D&S Termite guaranteed for one year. If certification is required D&S Termite must re inspect work completed by others. D&S Termite & Pest Control will apply primer coat, but cannot be responsible for match of color. If during the course of repair work, fungus and/or termite damage extends into inaccessible areas, there may be an additional charge for repairs. D&S Termite & Pest Control will contact you about additional charges if any.

****** This is a Section 1 Item *****

4. Other Findings:

FINDING 4A

FINDING: Moisture damage noted in door nex to refrigerator of residence, see 4A on diagram.

RECOMMENDATION 4A

RECOMMENDATION: Remove and replace or repair moisture damaged wood as needed. Work completed by D&S Termite guaranteed for one year. If certification is required D&S Termite must re inspect work completed by others. D&S Termite does not guarantee work completed by others. D&S Termite & Pest Control will apply primer coat, but cannot be responsible for match of color. If during the course of repair work, fungus and/or termite damage extends into inaccessible areas, there may be an additional charge for repairs. D&S Termite & Pest Control will contact you about additional charges if any.

****** This is a Section 1 Item ******

FINDING 4B

FINDING: Cracked shower enclosure tiles of residence, see 4B on diagram.

RECOMMENDATION 4B

RECOMMENDATION: Owner to contact licensed contractor to inspect and repair as needed.

******* This is a Section 2 Item *******

40mpi

Robinson Place, San Diego CA 92103

4/29/2022

420906

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

This is not a clearance, estimate void after one hundred twenty days it may be necessary to revise prices after one hundred twenty days.

D&S Termite & Pest Control will waive inspection fee if authorized to do work.

NOTE: Itemized cost estimates are valid only if <u>ALL</u> work is completed by D&S Termite Control. Prices may vary if partial items are requested, call office for details.

NOTICE: Under the Mechanic's Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has the right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your own contractor in full, if the subcontractor, laborer, or supplier remains unpaid.

NOTICE The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept D&S Termite Controls bid or you contract directly with another registered company licensed to perform the work.

If you choose to contract directly with another registered company, D&S Termite Control will not in any way be responsible for any act or omission in the performance of any work that you directly contract with another to perform.

AREAS INSPECTED:

1-SUB AREAS (soil conditions, accessibility, etc.)- dry / partly inaccessible due to construction

2-STALL SHOWERS(water tested? leaks?)- texted

3- FOUNDATIONS(type, relation to grade, etc.)- concrete

4-PORCHES-STEPS-concrete

5-VENTILATION(type, relation to grade, etc.)- adequate

6-ABUTMENTS(stucco walls, columns, arches, etc.)- none

7-ATTICS(accessibility, insulation, etc.)- mostly inaccessible due to construction

8-GARAGES(type, accessibility, etc.)- not inspected (detached)

9-DECKS/PATIOS- none

10-INTERIOR-inspected

11-EXTERIOR-inspected

****NOTICE****ANY REQUEST TO ALTER OR CORRECT ANY PART OF THIS REPORT IS SUBJECT TO A \$30.00 ADMINISTRATIVE FEE, PAYABLE AT TIME OF REQUEST.****

PAGE OF STANDARD INSPECTION REPORT ON PROPERTY AT:

	3	704	Robinson Place, San Diego CA 92103				4	/29/2022	420906	420906
	В	UILDING NO.	STREET, CITY, STATE, ZIP				IN	SPECTION DATE	REPORT N	0.
SECT	ION 1	ľ		SE	CTION 2			FURTHER IN	SPECTION	Į
2A	\$	2470.00		4B	Contractor					
2B	\$	3500.00								
2C	S	See 2B								
2D	5	See 2B								
3A	5	See 2B								
4A	5	See 2B								
Dron	osod	Cost Section 1:	\$5,970,00	Propo	sed Cost Section 2:	\$0.00		Proposed Cost F	Fur. Insp:	\$0.00

Robinson Place, San Diego CA 92103

BUILDING NO.	STREET, CITY, STATE, ZIP	INSPECTION DATE REPORT NO.
D & S Termite the control of the Structural	OCCUPANTS CHE Control will use pe wood destroying pes Pest Control report a	sticide chemical(s) specified below for ts or organisms in locations identified in
(1) The pest(s	s) to be controlled:	
SUBTER	RRANEAN TERMITES X DRY-WOOD TE	FUNGUS or DRY ROT RMITES OTHER
(2) The pestic	ide(s) proposed to be	used and the active ingredient(s):
X B. VIKAI ingredie X C. Chlor Other h	omethyl)phenyl)-4-((azole-3-carbonitrile NE: Active ingredients ents:02% -O-Pic (Chloropicrin) alonitroalkanes 3.5%	ts:Fipronil:5-amino-1(2,6-dichlor-4- 1,r,s)-(trifluoromethyl)sulfinyl) .9.1% Inert ingredients90.9% s: Sulfuryl Fluoride99.8% -Inert Active ingredients: Chloropicrin 96.5%
D. W/B	Copper-Green-Active ingredients 90.0%	ingredients: Copper Napthenate 10.0%
TOXIC CHEMIC Structural Pes the California Protection Age evidence, then are outweighe	quires that you be give CALS. Structural Pest it Control Board, and it Department of Pesticency. Registration is go are no appreciable and by the benefits. The lid be minimized.	en the following information: CAUTION—PESTICIDES ARE Control Companies are registered and regulated by the apply pesticides which are registered and approved for use by ide Regulation and the United States Environmental granted when the state finds that, based on existing scientific risks if proper use conditions are followed or that the risks e degree of risk depends upon the degree of exposure, so
illness compai	nours following applica rable to the flu, conta control company imr	ation you experience symptoms similar to common seasonal ct your physician or poison control center (1-619-692-8499) nediately."
the structure Control Cente chloropicrin, o	ted awareness, slowed immediately and seek r (619) 692-8499 and	hours you experience symptoms of dizziness, headache, if movement, garbled speech or difficulty in breathing, leave is medical attention by contacting your physician or Poison in notify your pest control company. The warning agent, of tearing, respiratory distress and vomiting. Entry into the late.
For further	r information, contact	any of the following:
SAN DIEG POISON C STRUCTUR	O COUNTY AGRICULT ONTROL CENTER RAL PEST CONTROL	EPARTMENT
Persons w concerned ab contact their treatment prior	vith respiratory or alloout their health rel physician concernin or to signing this NOT	ergic conditions, or others who may be ative to this chemical treatment, should g occupancy during and after chemical ICE.
NO CHEMICAL RETURNED. I RESPONSIBIL	APPLICATION WILL HAVING READ THE ITY FOR ALL THE AFC	BE PERFORMED UNTIL SUCH TIME THAT THIS NOTICE IS INSTRUCTIONS, I, THE UNDERSIGNED, WILL ACCEPT REMENTIONED.
OWNER/OCCU	JPANT	DATE
1	10-40-00 H	

4/29/2022

420906